

Work Order ID 58731

Tuesday, May 18, 2010 8:05:44 AM



Page 1

Item ID: D407-667-105TRN

Accept



Setup Start



Revision ID:

Item Name: Crosstube Turning Detail

Stop



Start Date: 5/18/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 5/25/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: Date: 105-18 Tooling: Date:
QC: Date: SPC (Y/N): Date:

Run Start



Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	----------------	--------------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D407-667-145	Rev C

100

0.00



MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DT8673 on both ends as per Folio FA249
2-Turn first side as per Folio FA249 3- File transition lines smooth.

Q.M. 10 - 05 - 19

110

QC1- Inspect dimensions to dimension sheet

0.00



QC

Memo

0.00

Quality Control

Q.M. 10 - 05 - 19

120

0.00



MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Turn second side as per Folio FA249 2- File transition lines smooth. 3-
Remove sand and plugs 4-Scribe part # and batch # using vibrating stylus as
per Dwg D206-667-145 Inside of Cuff(Do not engrave on outside of tube)

Q.M. 10 - 05 - 19

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 58731

Tuesday, May 18, 2010 8:05:44 AM



Page 2

Item ID: D407-667-105TRN

Accept



Setup Start



Revision ID:

Item Name: Crosstube Turning Detail

Stop



Start Date: 5/18/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 5/25/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start



Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run HoursDraw
NumberDraw
Rev.Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

130

QC1- Inspect dimensions to dimension sheet

0.00



QC

Memo

0.00

Quality Control

Q.M. 10-05-19

140

QC8- Inspect parts - second check

0.00



QC

Memo

0.00

Quality Control

MB 10-05-19

150

Crosstubes Chemical Conversion

0.00



HandFXtube

Memo

0.00

Hand Finishing Crosstubes

(14) MB 10-05-20

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 58731

Tuesday, May 18, 2010 8:05:44 AM



Page 3

Item ID: D407-667-105TRN

Accept



Setup Start



Revision ID:

Item Name: Crosstube Turning Detail

Stop



Start Date: 5/18/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 5/25/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run HoursDraw
NumberDraw
Rev.Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

160



QC

Quality Control

QC3- Inspect Part Finish

0.00

Memo

0.00



BE 10/05/20

170



Packaging

Packaging

Packaging

Memo

Identify and stock in Kanban rack ☐ Location: X-tube cel

0.00

0.00



MB 10-05-20

180



QC

Quality Control

QC21- Final Inspection - Work Order Release

0.00

Memo

0.00

10/05/20

u 10/05/20

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Tuesday, May 18, 2010 8:05:50 AM

Page 1

Work Order ID: 58731

Parent Item: D407-667-105TRN

Parent Item Name: Crosstube Turning Detail



Comments: IPP Rev:a 08.02.28 new issue EC
IPP Rev B 08.04.02 Removed polish EC verified by: DD

Start Date: 5/18/2010

Required Date: 5/25/2010

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Qty Issued	Date Issued	Status	
D6010-115		Manufactured	No			110	Each	47.0000	1				
											<u>A.A 10-05-190</u>		
Crosstube Material													

Location	Loc Qty	Loc Code
LG	47	
26424	2	
32308	2	
38343	43	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order:	58731
Description: Crosstube Assembly	Part Number:	D407-667-145
Inspection Dwg: D407-667-145 Rev: C		Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article
 ☐ Prototype

Inspection Sheet	Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005/-0.000	2.240	/			
	1.865	+0.005/-0.000	1.870	/			
	1.878	+0.005/-0.000	1.883	/			
	1.970	+0.005/-0.000	1.975	/			
	2.030	+0.005/-0.000	2.035	/			
	2.165	+0.005/-0.000	2.170	/			
	0.125	+/-0.010	0.125	/			
	R0.063	+/-0.010	R0.063	/			
	R0.500	+/-0.010	R0.500	/			
	R0.063	+/-0.010	R0.063	/			
	4.438	+/-0.010	4.438	/			
SIDE B	2.240	+0.005/-0.000	2.240	/			
	1.865	+0.005/-0.000	1.870	/			
	1.878	+0.005/-0.000	1.883	/			
	1.970	+0.005/-0.000	1.975	/			
	2.030	+0.005/-0.000	2.035	/			
	2.165	+0.005/-0.000	2.170	/			
	0.125	+/-0.010	0.125	/			
	R0.063	+/-0.010	R0.063	/			
	R0.500	+/-0.010	R0.500	/			
	R0.063	+/-0.010	R0.063	/			
	4.438	+/-0.010	4.438	/			
	113.20	+/-0.020	113.200	/			

Measured by:	Q.M	Audited by:	MB	Prototype Approval:	N/A
Date:	10-05-19	Date:	10-05-19	Date:	N/A

Rev	Date	Change	Revised by	Approved
A	04.04.21	New Issue (P/O D407-667-105)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM	
C	09.06.11	Dwg Rev updated	KJ	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Item	Qty -145	Part Number	Description
1	X	D407-667-145	CROSSTUBE ASSEMBLY (407 HIGH FWD)
2	1	D6010-115	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2891-1	SUPPORT
6	4	D3595-063-395	RUBBER CUSHION
7	4	MS21920-20	CLAMP (OR MS21920-21)
8	14	MS20601AD4W10	RIVET (OR NAS9302B-4-10)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299- 947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6010-115
FINISHED LENGTH = 113.20±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D407-667-145" AND BATCH NUMBER ON
INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 17.8 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY,
TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 6 PASSES. MAXIMUM TUBE FLATTENING DUE
TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2891-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER
QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-20 CLAMPS (OR -21) WITH D3595-063-395 RUBBER CUSHIONS TO SECURE
THE D2891-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS
ARE LOCATED ON CROSSTUBE SUPPORTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN
SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 58731
BS10-5-15

RELEASED
03/11/12

C	REVISE GENERAL NOTES/PART LIST (ZN D7-1); REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS. D3595-063-395 WAS D2856-400-694 (ZN D6-2 & A5-2); REMOVED REF. 7 ADD TOLERANCES (ZN C6-3, C4-3, D2-3); RELOCATED FLAG #6 (ZN A8-3) PER NCR 210; MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	08.11.06
B	ADD HOLES AND NUT PLATES FOR COMPATABILITY WITH BHT/AA SKUDTUBES	PH	05.07.26
A	NEW ISSUE	CP	02.05.08
REV.	DESCRIPTION	BY	DATE
DESIGN	90		
DRAWN	RF		
CHECKED	CP		
MFG. APPR.	CP		
APPROVED	CP		
DE APPR.	CP		
DATE	08.11.06		

DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWING NO. D407-667-145	REV. C SHEET 1 OF 4
TITLE CROSSTUBE ASS'Y (407 HIGH FWD)	SCALE NTS
COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

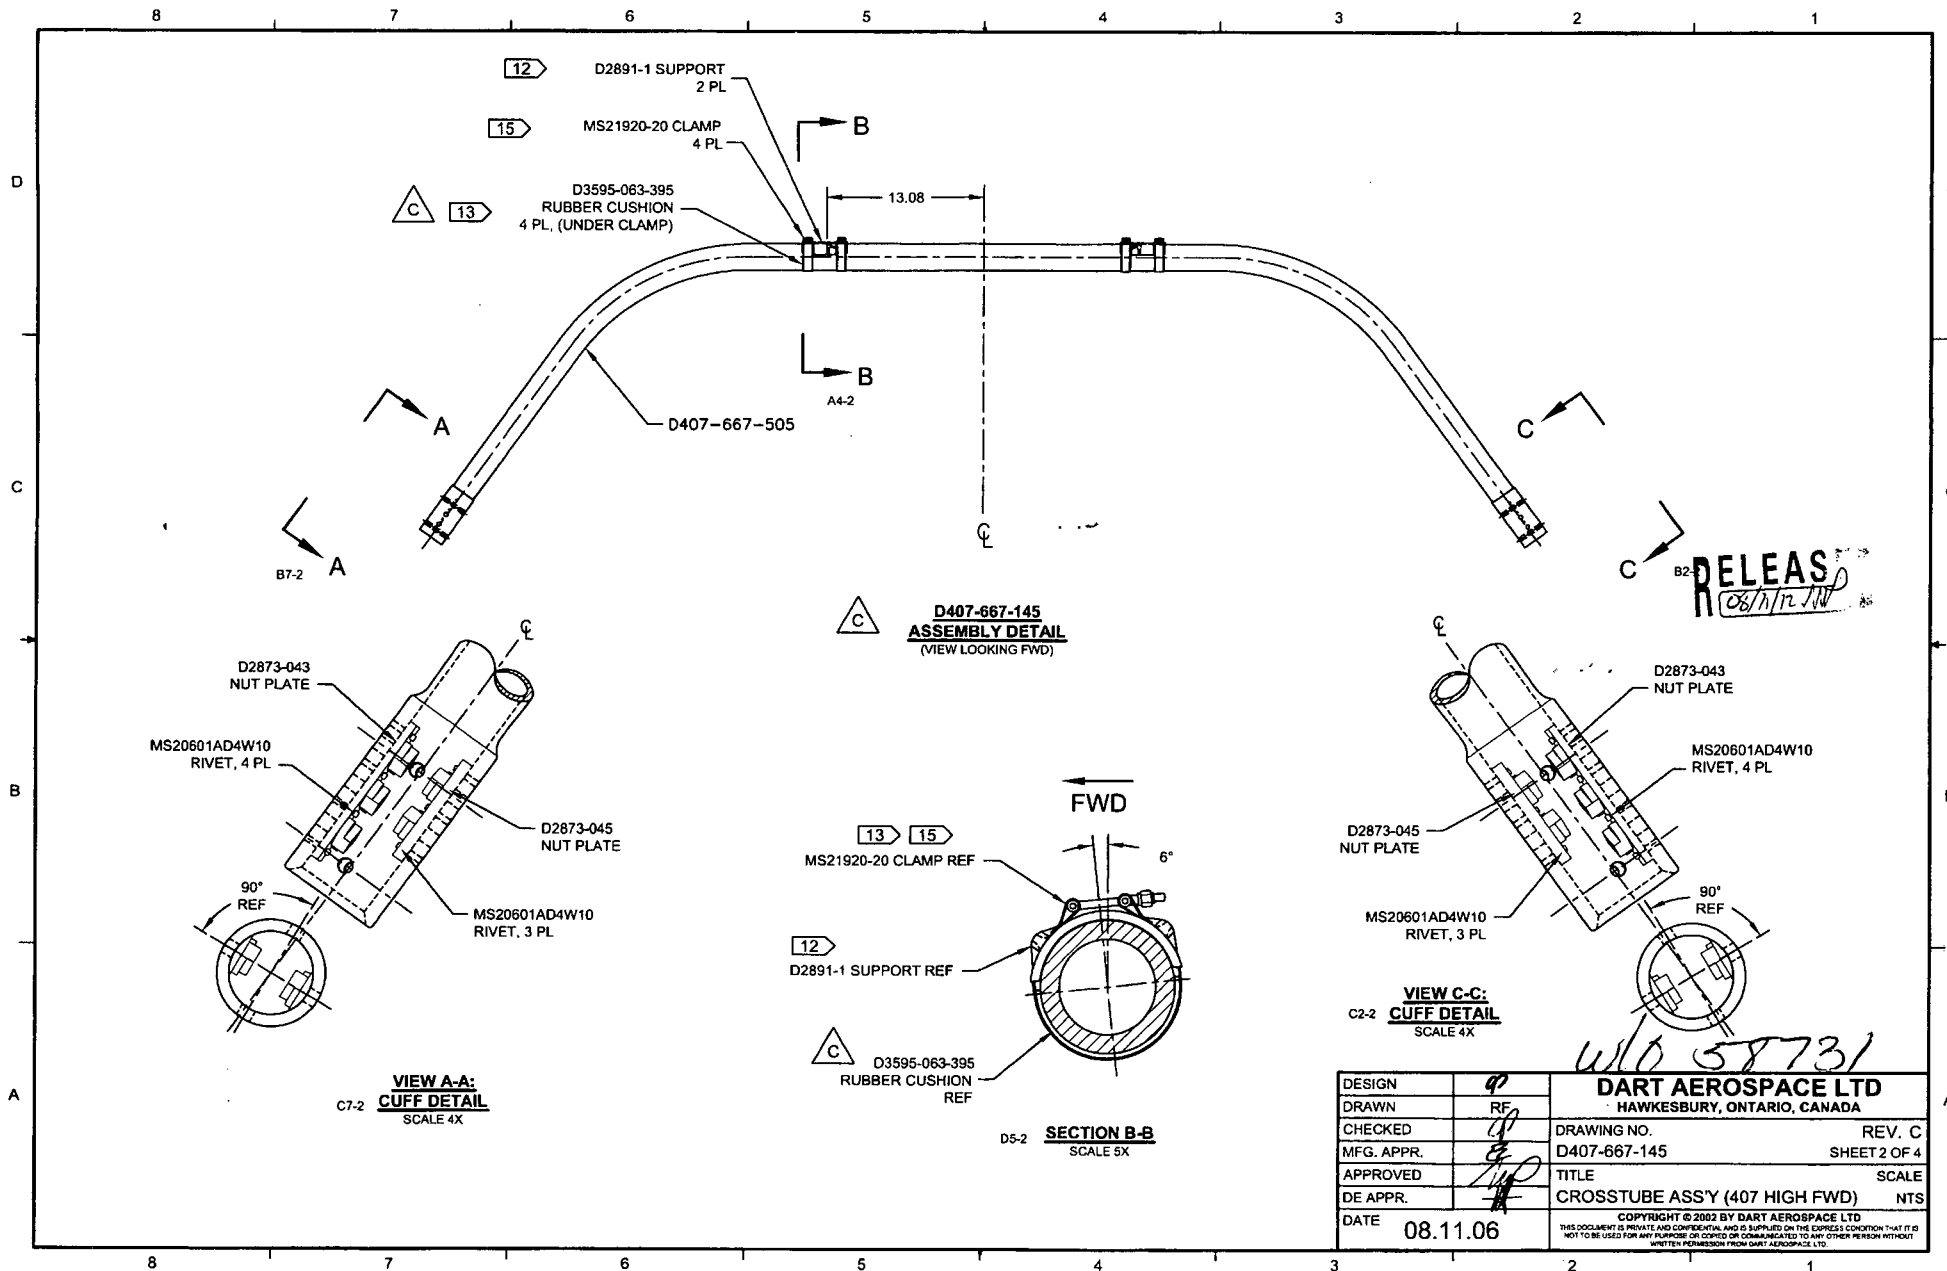

DESIGN	97	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	UP	DRAWING NO.	REV. C
MFG. APPR.	EP	D407-667-145	SHEET 2 OF 4
APPROVED	EP	TITLE	SCALE
DE APPR.	EP	CROSSTUBE ASSY (407 HIGH FWD)	NTS
DATE	08.11.06	COPYRIGHT © 2002 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

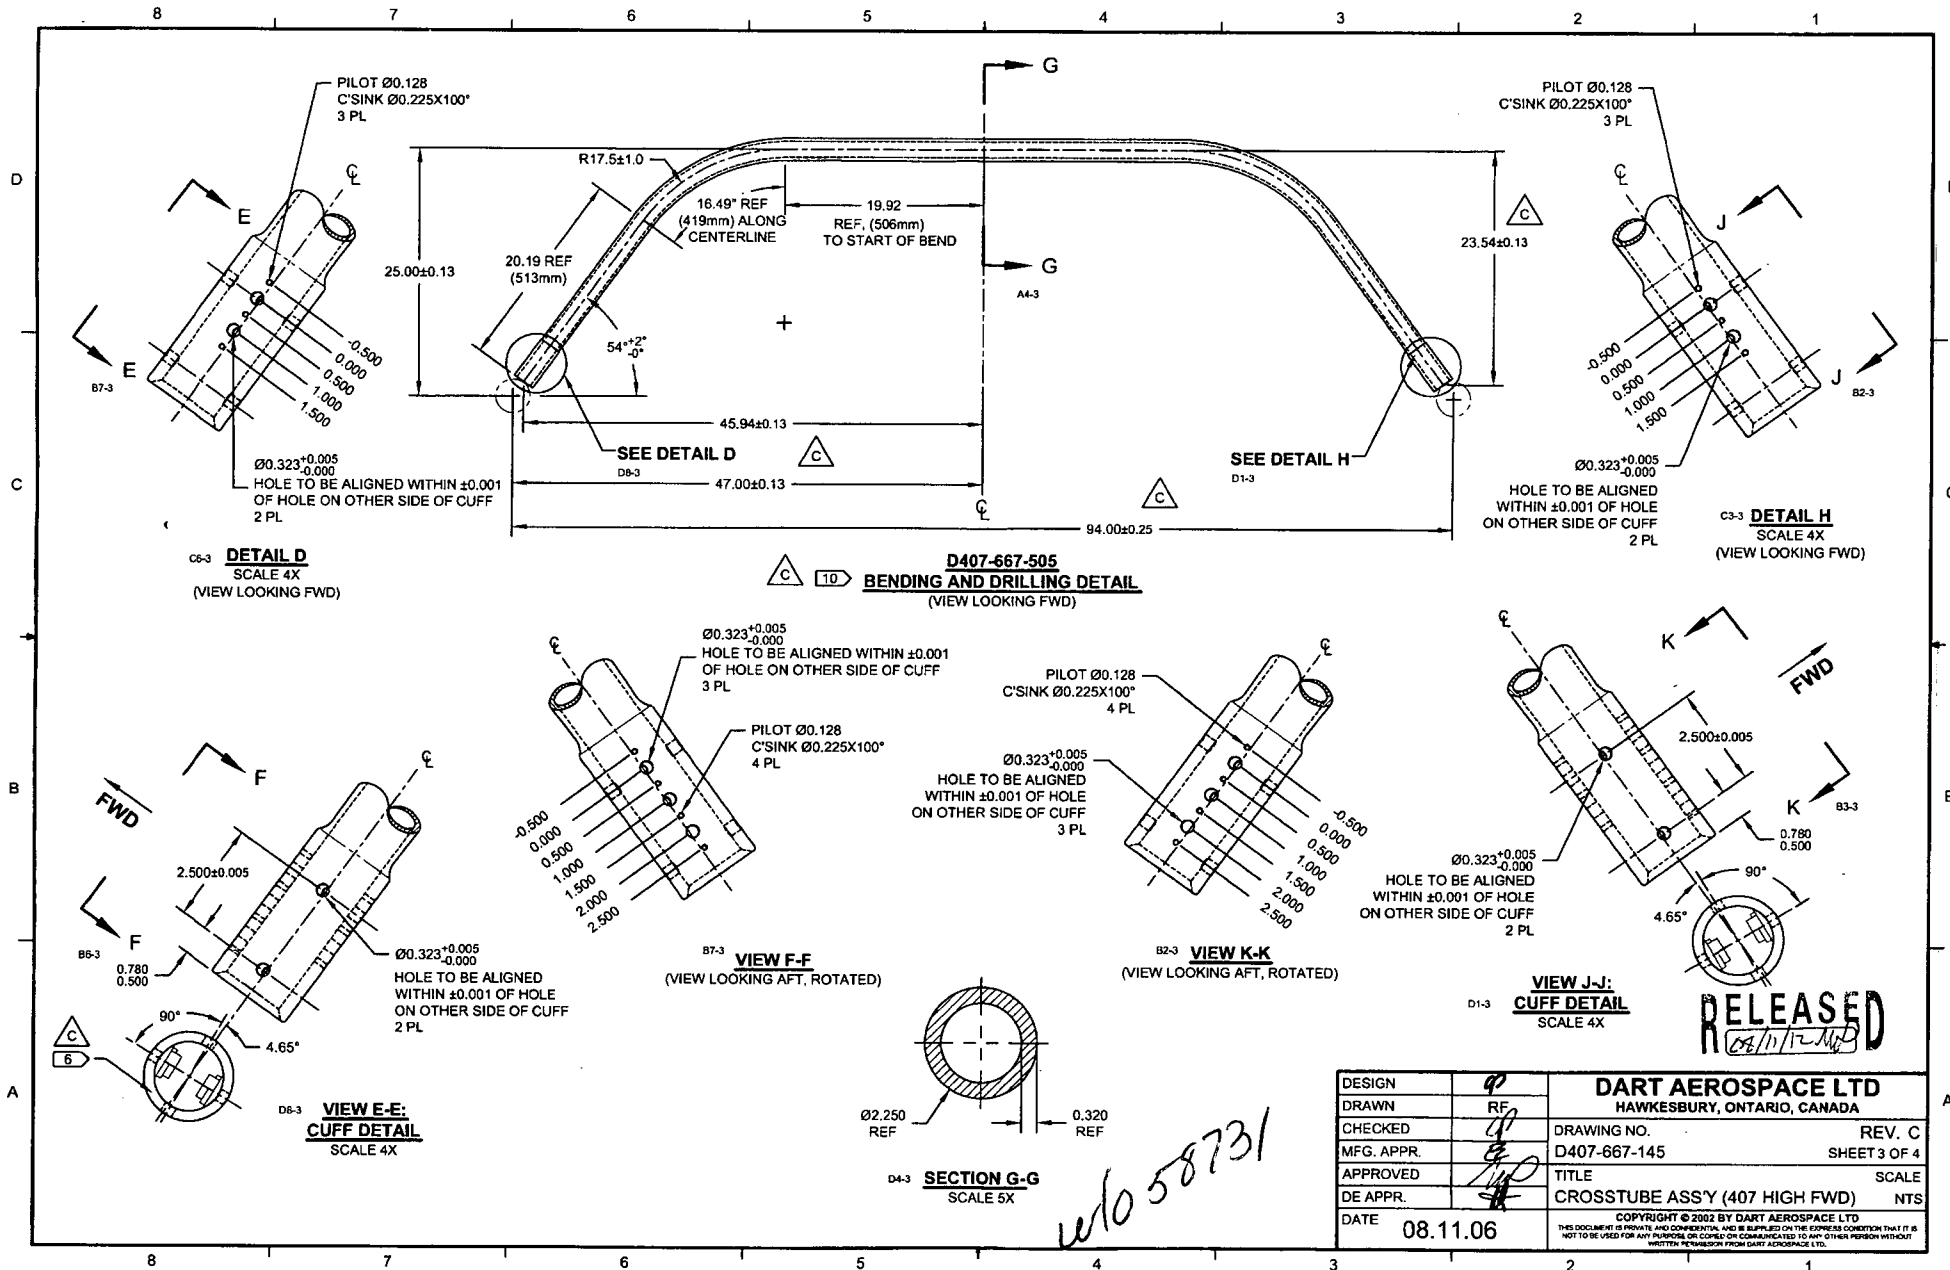


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

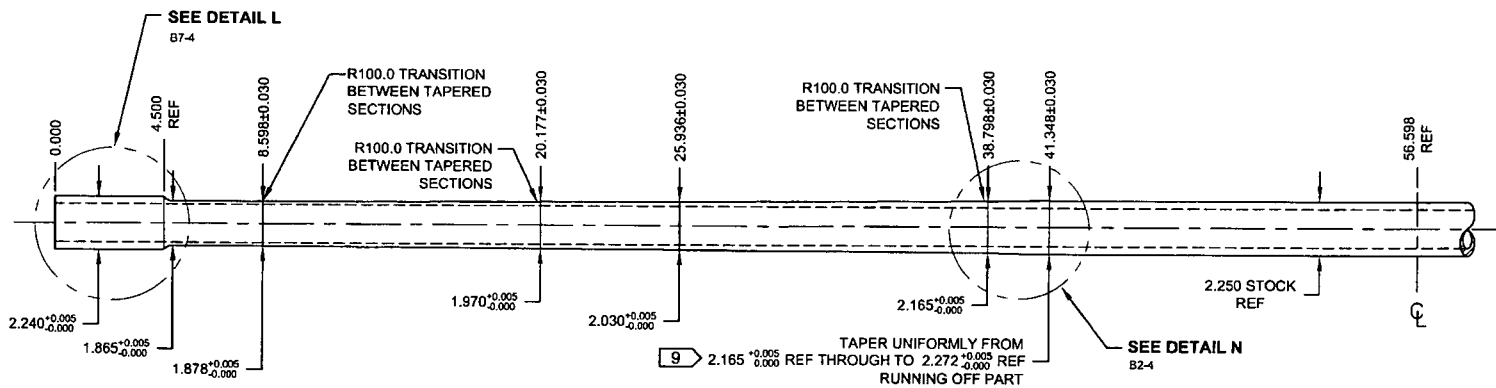


TURNING DETAIL

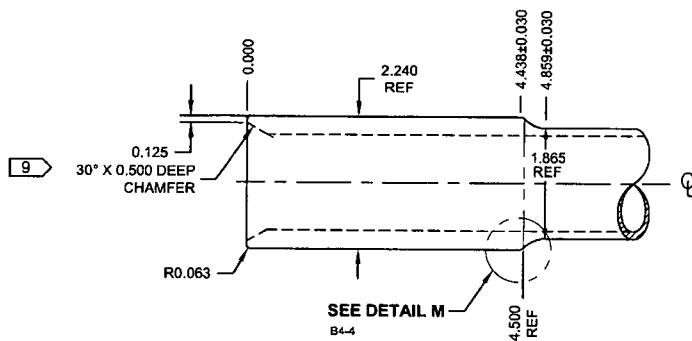

**DETAIL L:
CROSSTUBE CUFF**
NOT TO SCALE

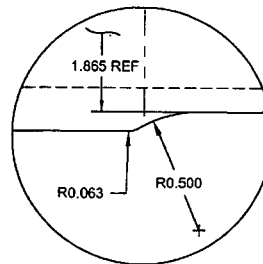

**DETAIL M:
CUFF TRANSITION**
NOT TO SCALE

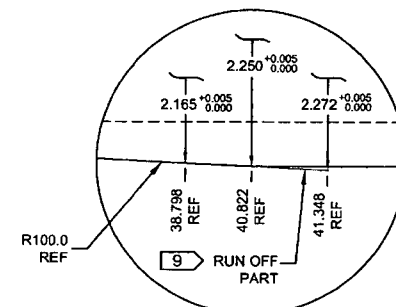

**DETAIL N:
TAPER RUN-OFF**
NOT TO SCALE

DESIGN	9	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. C
MFG. APPR.	RF	D407-667-145	SHEET 4 OF 4
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	CROSSTUBE ASS'Y (407 HIGH FWD)	NTS
DATE	08.11.06	COPYRIGHT © 2002 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD			

RELEASED
08/11/2006

W1058731

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries